


NOTICE: OUTDATED TEXT
DO NOT RELY UPON THIS TEXT. THIS TEXT IS FOR
INFORMATION PURPOSES ONLY. FOR CURRENT
INFORMATION, CONTACT
J.H. FLETCHER & CO.
RISK MANAGEMENT DEPT.

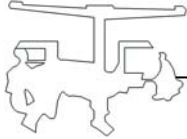

J. H. FLETCHER & CO. Box 2187 – Huntington, WV 25722-2187 – 304/525-7811 – FAX 304/525-4025

IMPORTANT SAFETY DESIGN NOTICE

INFORMATION BULLETIN NO. 22

TO: OWNERS AND OPERATORS OF FLETCHER ROOF DRILLS

**FROM: J.H. FLETCHER & CO.
RISK MANAGEMENT DEPARTMENT**

DATE: DECEMBER 1980

SUBJECT: FRONT END LIFT ARRANGEMENT ON MODELS DDO AND DDJ

Problem:

The allen head screws in the retaining cap for the bronze bushing begin to back out after continued use of the front end lift system.

Solution:

To prevent this occurrence, tack weld the allen head screws along with welding the retaining cap to the pivot plate.

See the attached drawing.

Contact the Risk Management Department with any questions.

